


CLS : CLOSE LIMIT SWITCH (250VAC 6A)
OLS : OPEN LIMIT SWITCH (250VAC 6A)
CTS : CLOSE TORQUE SWITCH (250VAC 6A)
OTS : OPEN TORQUE SWITCH (250VAC 6A)
ACLS : AUX. CLOSE LIMIT SWITCH (250VAC 6A)
AOLS : AUX. OPEN LIMIT SWITCH (250VAC 6A)
TP : THERMAL PROTECTOR

CLOSE		OPEN	
CLS 1-2			
CLS 1-3			
OLS 1-2			
OLS 1-3			
ACLS 1-2			
ACLS 1-3			
AOLS 1-2			
AOLS 1-3			
CTS 1-3		* CLOSING TORQUE SWITCH INTERRUPTS CONTROL IF MECHANICAL OVERLOAD OCCURS DURING CLOSING CYCLE	
OTS 1-3		* OPENING TORQUE SWITCH INTERRUPTS CONTROL IF MACHANICAL OVERLOAD OCCURS DURING OPENING CYCLE	

AC 1PH (V)

PROPOSE CUSTOMER'S WIRING
ACTUATOR WIRING

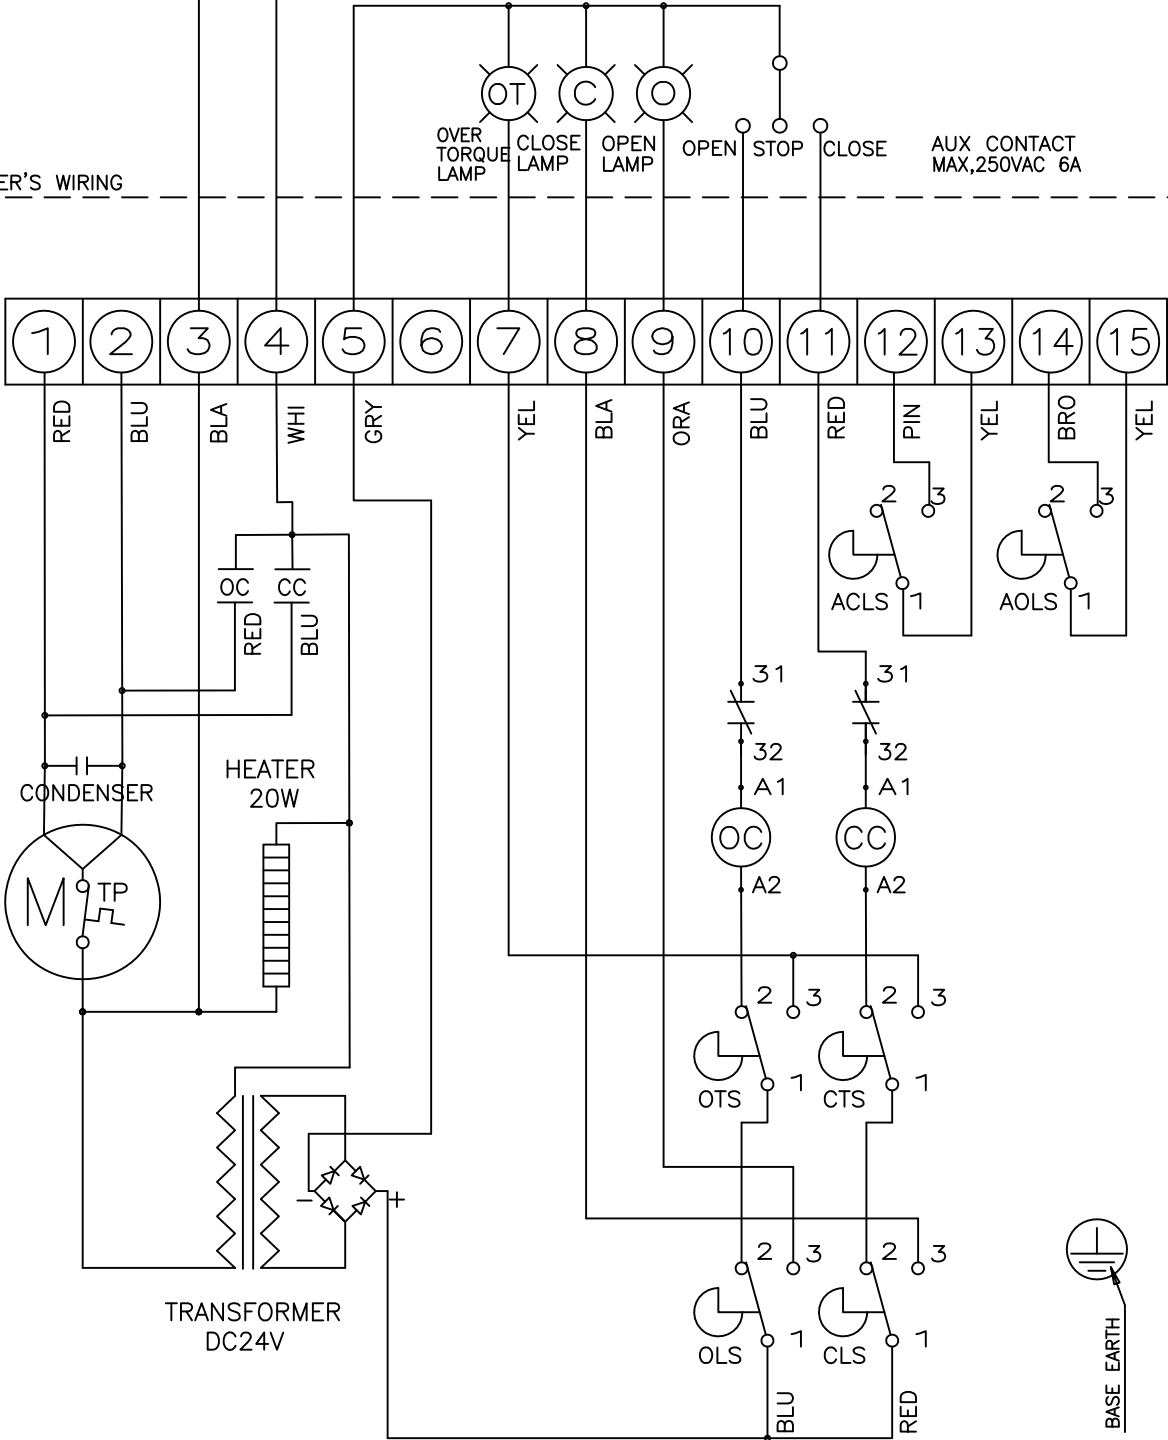

A050	1	A250	1	△					
A038	1	A200	1	SYM	E C N NO	CHANGES	DATE	SIGN	APPD
A028	1	A150	1	DRAW	H,J KWON	PART NAME 1PH WIRING DIAGRAM ALS,IMS(DC24V CONTROL)			
A019	1	A100	1	CHECK					
A015	1	A080	1	APPD					
APPLICATION		A060	1	DATE	'15,11,20	DWG NO.	NS-124AO-B		