


CLS : CLOSE LIMIT SWITCH (250VAC 16A)
 OLS : OPEN LIMIT SWITCH (250VAC 16A)
 CTS : CLOSE TORQUE SWITCH (250VAC 16A)
 OTS : OPEN TORQUE SWITCH (250VAC 16A)
 ACLS : AUX. CLOSE LIMIT SWITCH (250VAC 16A)
 AOLS : AUX.OPEN LIMIT SWITCH (250VAC 16A)
 TP : THERMAL PROTECTOR

	CLOSE	OPEN
CLS 1-2		
CLS 1-3		
OLS 1-2		
OLS 1-3		
ACLS 1-3		
AOLS 1-3		
CTS 1-3	* CLOSING TORQUE SWITCH INTERRUPTS CONTROL IF MECHANICAL OVERLOAD OCCURS DURING CLOSING CYCLE	
OTS 1-3	* OPENING TORQUE SWITCH INTERRUPTS CONTROL IF MECHANICAL OVERLOAD OCCURS DURING OPENING CYCLE	

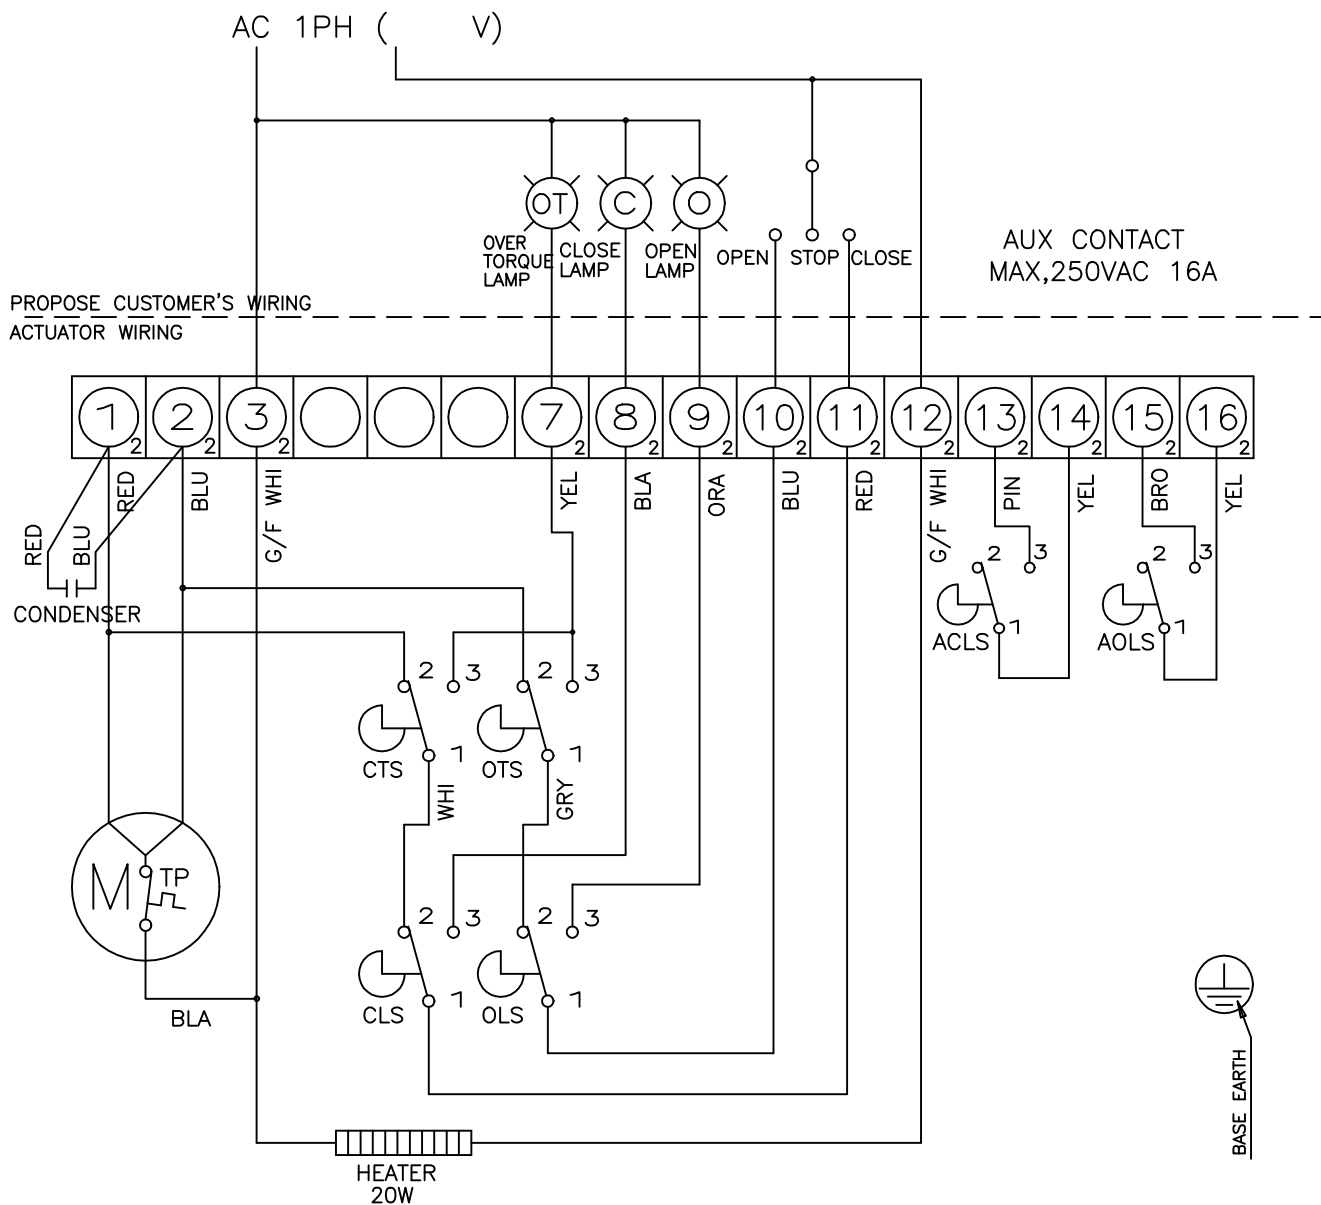

A050	1	A300	1	△					
A038	1	A200	1	SYM	E C N NO	CHANGES	DATE	SIGN	APPD
A028	1	A150	1	DRAW	H.S PARK	PART NAME 1PH WIRING DIAGRAM ALS			
A019	1	A100	1	CHECK					
A015	1	A080	1	APPD		DWG NO. NS-12000-C			
APPLICATION	A060	1	DATE	'23.08.22					